



TA 40

TA 40	40	26
	45	26

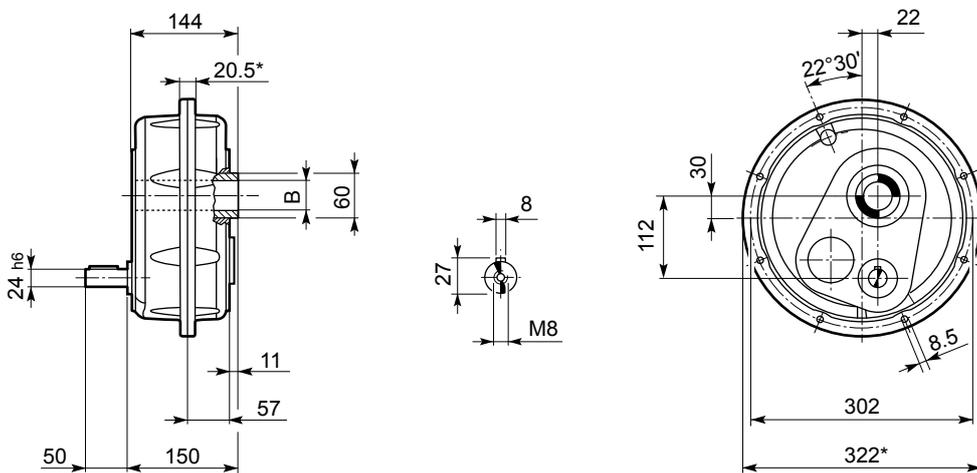

TA 40_D

TA 40	40	28
	45 D	28

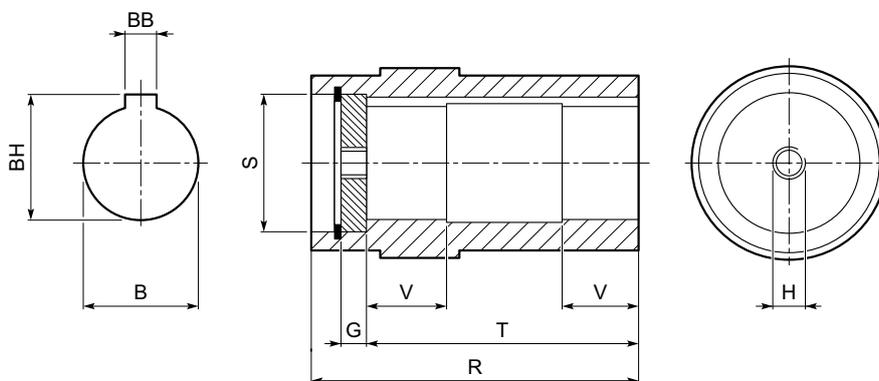

OUTPUT


		B G7	BB	BH	G	H	R	S	T	V
TA 40	40	40	12	43.3	12	M12	144	50	124	30
	45	45	14	47.3	12	M12	144	50	124	30

* Le superfici sono grezze

* Surfaces are unmachined

* Oberflächen nicht bearbeitet

* Les surfaces sont non-usinées

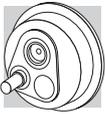

TA 40 **950 Nm**

 	i	n ₁ = 1400 min ⁻¹				n ₁ = 900 min ⁻¹				n ₁ = 500 min ⁻¹				
		n ₂ min ⁻¹	Mn ₂ Nm	Pn ₁ kW	Rn ₁ N	n ₂ min ⁻¹	Mn ₂ Nm	Pn ₁ kW	Rn ₁ N	n ₂ min ⁻¹	Mn ₂ Nm	Pn ₁ kW	Rn ₁ N	
TA 40 40 45	5	280	480	14.4	1.000	180	550	10.6	1.200	100	700	7.5	1500	21
TA 40 40 45 D	10	140	600	9.2	850	90	750	7.4	950	50	800	4.4	1200	
	13.3	105	700	8.1	850	68	780	5.8	950	38	820	3.4	1200	
	15	93	750	7.7	850	60	800	5.3	950	33	850	3.1	1200	
	19.7	71	780	6.1	850	46	800	4.0	950	25.4	850	2.4	1200	
	25	56	800	4.9	850	36	850	3.4	950	20.0	900	2.0	1200	
	33.2	42	800	3.7	850	27.1	900	2.7	950	15.1	950	1.6	1200	