


TA 60


TA 60

TA 60	60	83
	70	83

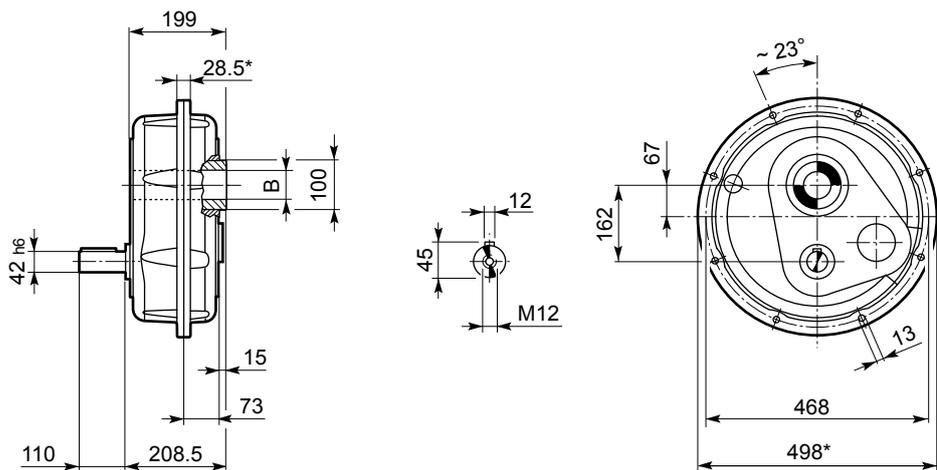


TA 60_D

TA 60	60 D	97
	70	97

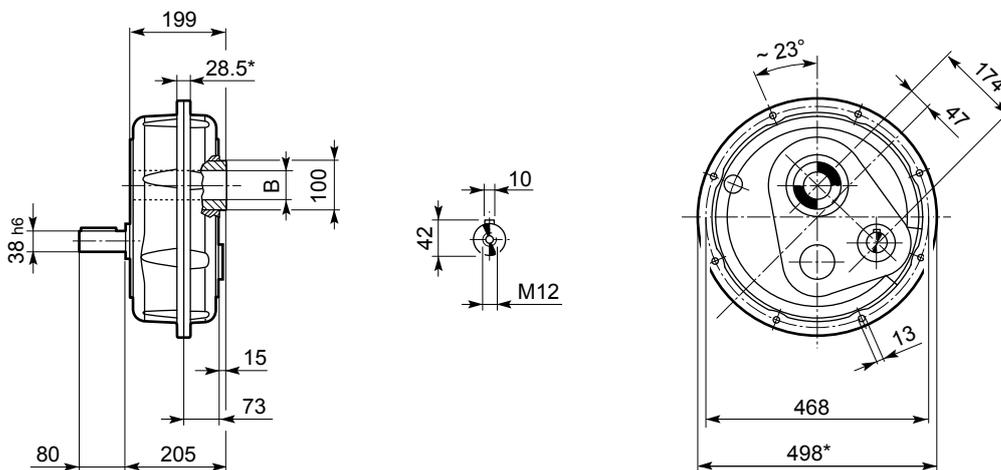

OUTPUT

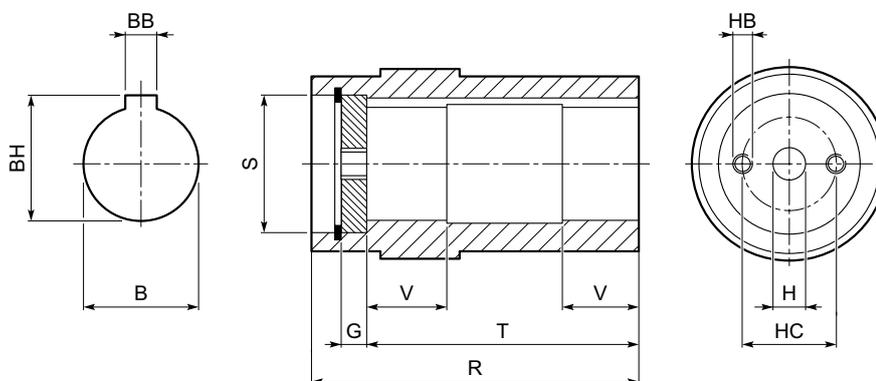

		B G7	BB	BH	G	H	HB	HC	R	S	T	V
TA 60	60	60	18	64.4	14	17	M12	42	199	70	175	45
	70	70	20	74.9	16	22	M16	50	199	85	175	45

* Le superfici sono grezze

* Surfaces are unmachined

* Oberflächen nicht bearbeitet

* Les surfaces sont non-usinées



3600 Nm

TA 60

 	i	$n_1 = 1400 \text{ min}^{-1}$				$n_1 = 900 \text{ min}^{-1}$				$n_1 = 500 \text{ min}^{-1}$				
		n_2 min ⁻¹	Mn_2 Nm	Pn_1 kW	Rn_1 N	n_2 min ⁻¹	Mn_2 Nm	Pn_1 kW	Rn_1 N	n_2 min ⁻¹	Mn_2 Nm	Pn_1 kW	Rn_1 N	
TA 60 60 70	5	280	1900	57	3200	180	2100	41	3600	100	2900	32	4500	24
TA 60 60 70 D	10	140	3100	48	2600	90	3200	32	2900	50	3300	18.2	3600	
	12.2	115	3100	39	2600	74	3200	26	2900	41	3300	14.9	3600	
	15	93	3200	33	2600	60	3300	22	2900	33	3550	13.0	3600	
	20.3	69	3250	25	2600	44	3400	16.6	2900	24.6	3550	9.6	3600	
	25	56	3300	20	2600	36	3500	13.9	2900	20.0	3600	7.9	3600	
	30.4	46	3300	16.7	2600	29.6	3500	11.4	2900	16.4	3600	6.5	3600	