


TA 35


TA 35

	
TA 35	16

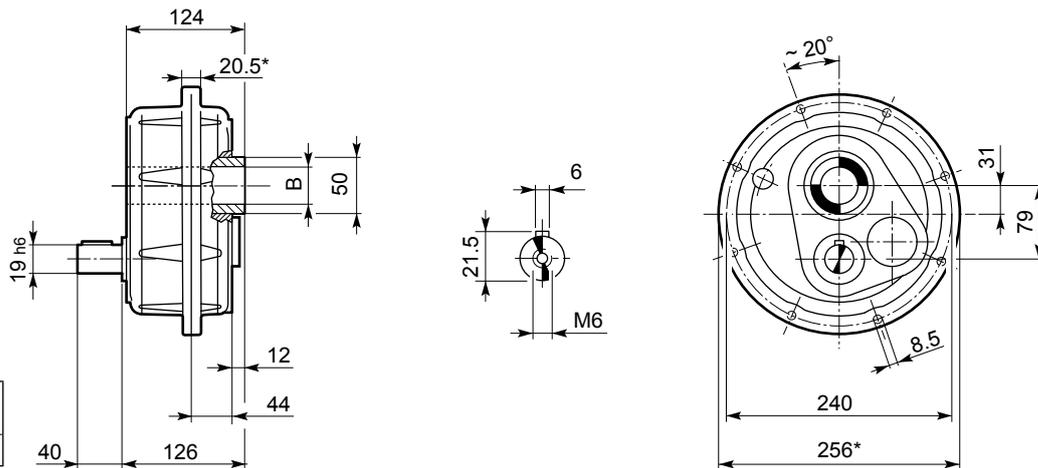


TA 35_D

	
TA 35 D	18

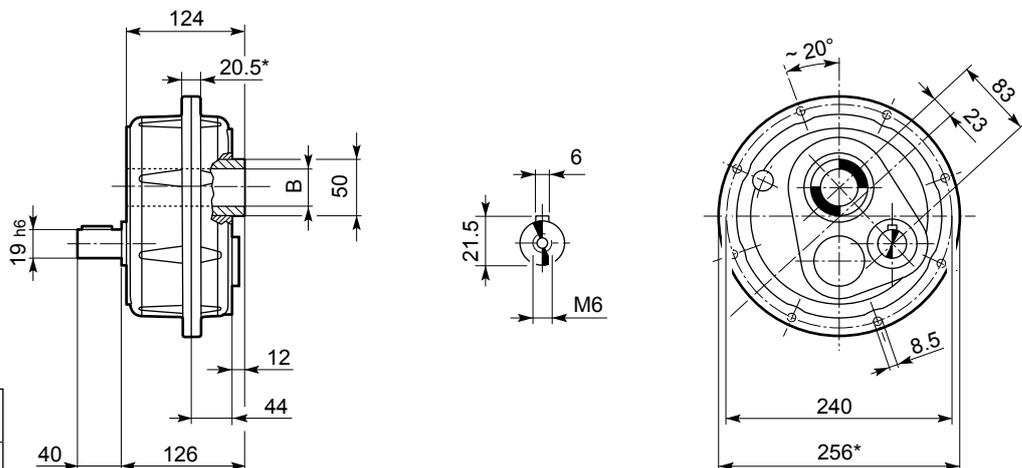

OUTPUT

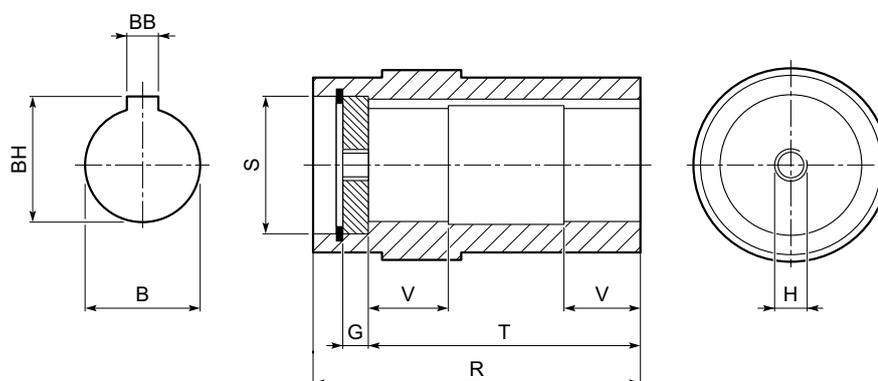


	B _{G7}	BB	BH	G	H	R	S	T	V
TA 35	35	10	38.3	10	M10	124	42	106	30

* Le superfici sono grezze

* Surfaces are unmachined

* Oberflächen nicht bearbeitet

* Les surfaces sont non-usinées

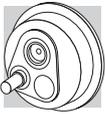

TA 35 **420 Nm**

 	i	n ₁ = 1400 min ⁻¹				n ₁ = 900 min ⁻¹				n ₁ = 500 min ⁻¹				
		n ₂ min ⁻¹	Mn ₂ Nm	Pn ₁ kW	Rn ₁ N	n ₂ min ⁻¹	Mn ₂ Nm	Pn ₁ kW	Rn ₁ N	n ₂ min ⁻¹	Mn ₂ Nm	Pn ₁ kW	Rn ₁ N	
TA 35 35	5	280	200	6.0	700	180	250	4.8	800	100	350	3.8	1000	20
	10	140	300	4.6	500	90	350	3.5	600	50	400	2.2	750	
TA 35 35 D	15	93	350	3.6	500	60	400	2.6	600	33	400	1.5	750	
	19.5	72	380	3.0	500	46	400	2.0	600	25.6	400	1.1	750	
	25	56	400	2.5	500	36	400	1.6	600	20.0	420	0.92	750	